

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION

(1) County Putnam(2) Township Southeast


(3) DEC Well Number

P1643

WELL COMPLETION REPORT

(4) OWNER Mid Hudson Realty			LOG *	
(5) ADDRESS 1699 Route 6, Suite 1, Carmel, NY 10512			Ground Surface EL. _____ ft. above sea level	
(6) LOCATION OF WELL (See Instructions On Reverse) Show Lat/Long if available and method used: 176 John Simpson Road, Town of Southeast, NY <input type="checkbox"/> GPS <input type="checkbox"/> DEC Website <input type="checkbox"/> Map Interpolation			Top Of Casing is located <u>+1</u> ft. above (+) or below (-) ground surface	
(7) DEPTH OF WELL BELOW LAND SURFACE (Feet) 205' 60+ gpm		(8) DEPTH TO GROUNDWATER BELOW LAND SURFACE (Feet) N/A		DATE MEASURED
(9) DIAMETER 6" in. in. in. in.			TOP OF WELL	
(10) LENGTH 112 ft. ft. ft. in.			0'	
(11) GROUT TYPE / SEALING portland cement		(12) GROUT / SEALING INTERVAL (Feet) FROM 90' To 112'		
(13) MAKE & MATERIAL			(14) OPENINGS	
(15) DIAMETER in. in. in. in.			90'	
(16) LENGTH ft. ft. ft. in.			Drilling in overburden clay and	
(17) DEPTH TO TOP OF SCREEN, FROM TOP OF CASING (Feet)			90'	
(18) DATE 5/11/01			(19) DURATION OF TEST 6 hours	
(20) LIFT METHOD <input checked="" type="checkbox"/> Pump <input type="checkbox"/> Air Lift <input type="checkbox"/> Bail			(21) STABILIZED DISCHARGE (GPM) 7 gpm	
(22) STATIC LEVEL PRIOR TO TEST (feet/inches below top of casing) 40'			(23) MAXIMUM DRAWDOWN (Stabilized) (feet/inches below top of casing) 140'	
(24) RECOVERY (Time in hours/minutes) 15 minutes			(25) Was the water produced during test discharged away from immediate area? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
PUMP INSTALLATION				
(26) PUMP INSTALLED? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>		(27) DATE 5/11/01		(28) PUMP INSTALLER P. F. Beal & Sons, Inc.
(29) TYPE submersible		(30) MAKE Goulds		(31) MODEL 7GS05412
(32) MAXIMUM CAPACITY (GPM) 7 gpm		(33) PUMP INSTALLATION LEVEL FROM TOP OF CASING (Feet) 160'		
(34) METHOD OF DRILLING <input checked="" type="checkbox"/> Rotary <input type="checkbox"/> Cable Tool <input type="checkbox"/> Other _____		(35) USE OF WATER (see instructions for choices) residential		
(36) DATE DRILLING WORK STARTED 5/7/01		(37) DATE DRILLING WORK COMPLETED 5/7/01		
(38) DATE REPORT FILED		(39) DRILLER & COMPANY Perry L. Beal P. F. Beal & Sons, Inc.		(40) DEC REGISTRATION NO. NYRD10105
* Show log of geologic materials encountered with depth below ground surface, water bearing beds and water levels in each; casings; screens; pump; additional pumping tests and other matters of interest, e.g., water quality (sulphur, salt, methane). Describe repair work. Attach separate sheet if necessary.			203'	
See further instructions titled "Instructions for New York State Well Completion Report".			BOTTOM OF HOLE	
NYSDEC COPY				

LOCATION SKETCH - Indicate north

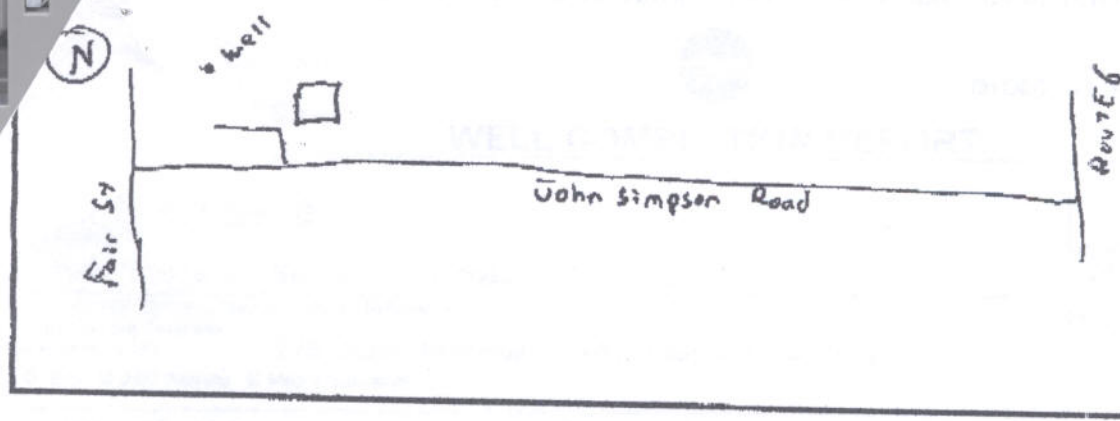

P1643

Target is 41° 25' 35"N, 73° 38' 53"W - **LAKE CARMEL** quad [\[Quad](#)

[Info\]](#)

1:25,000 1:50,000 1:100,000 1:200,000


Small

Medium

Large

topozone.com

Copyright © 2000 Maps a la carte, Inc.

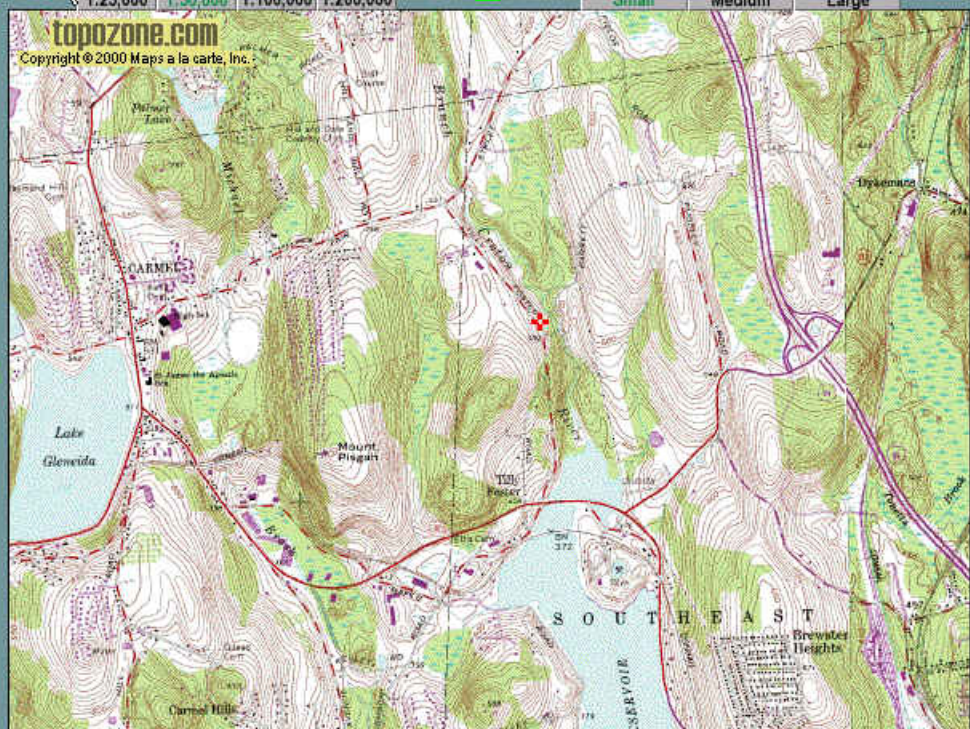

0 1000 2000 3000 4000
meters
0 1.0 2.0
miles

Coordinates (NAD27): ☐ UTM ☐ DD.DDDD ☒ D/M/S ☒ Show target